
9 Exploded view FK 101.2

FK 101.2: schematic view for parts identification, not a dimensional drawing. Valve (19) shown as a separate CAD detail. Blue links open the corresponding shop article.

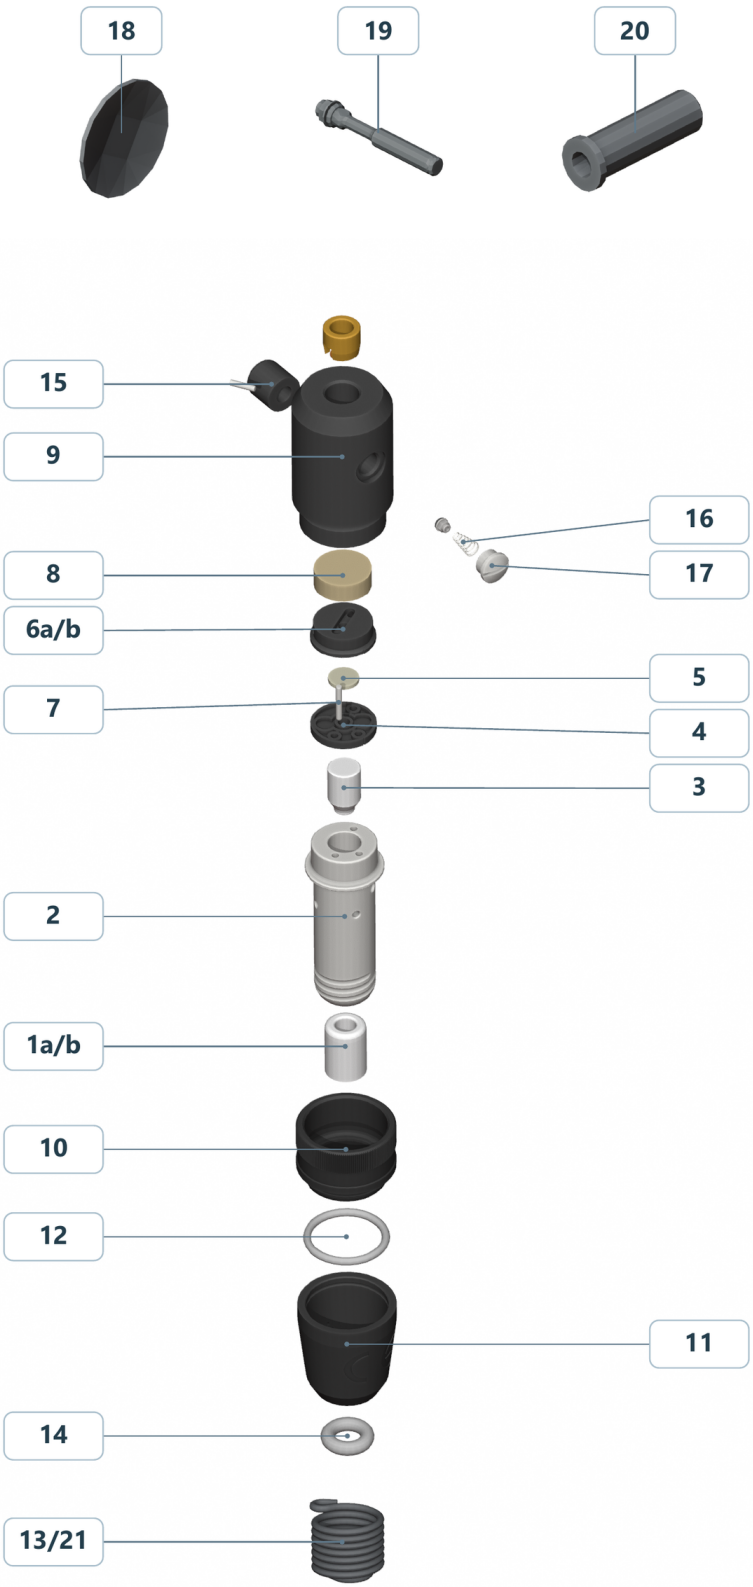

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bushing	052-7232
1b	1	Bushing	052-7233
2	1	Cylinder	052-0012
3	1	Piston	052-0352
4	1	Lower cover	052-0051
5	1	Valve plate	307-2337
6a	1	Upper cover	052-0050
6b	1	Upper cover	052-0054
7	1	Pin	304-5646
8	1	Buffer	307-2338
9	1	Complete housing	052-0063
10	1	Clamping nut	052-0058
11	1	Silencer	307-2540
12	1	O-ring	307-2439
14	1	O-ring	307-2076
15	1	Trigger	307-2339
16	1	Spring	304-7015
17	1	Plug	306-0200
18	1	Strainer	304-5069
19	1	Complete valve	052-0142
20	1	Valve bushing	052-0141
13	1	Oval spring cap	304-7806
21	1	Spring cap	304-7807

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the upper cover, lower cover or control plate can damage the hammer. Always replace buffer 307-2338 during this work. Replace upper cover, lower cover and control plate together.

Variants and spare-parts orders
Variants: 052-5183 → bush 1b and upper cover 6a; 052-5182 → bush 1a and upper cover 6b. Spring cap 13 applies to both variants; item 21 is the alternative for cutting edges from 40 mm wide. State tool type, article number and shank when ordering.