

9 Exploded view FK 113.1

FK 113.1: item numbers correspond to the version shown. Blue links open the corresponding shop article.

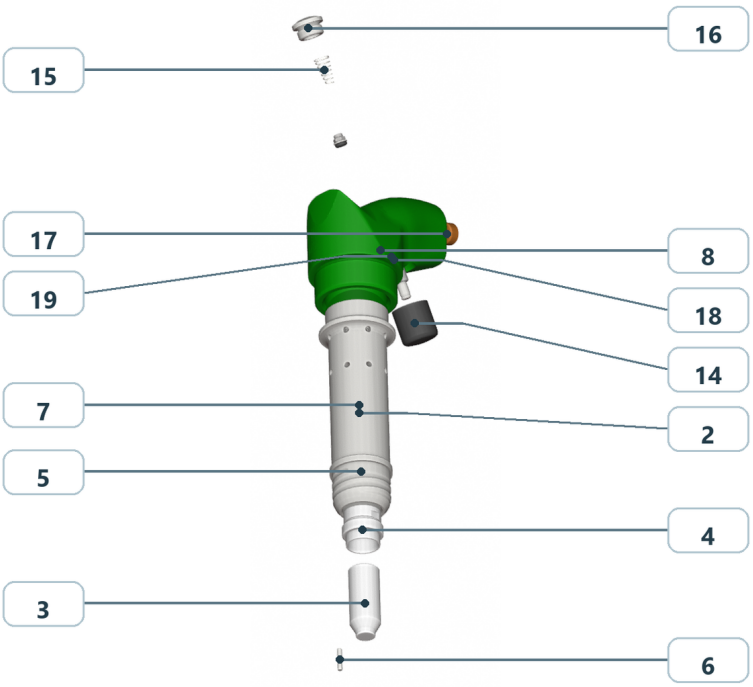

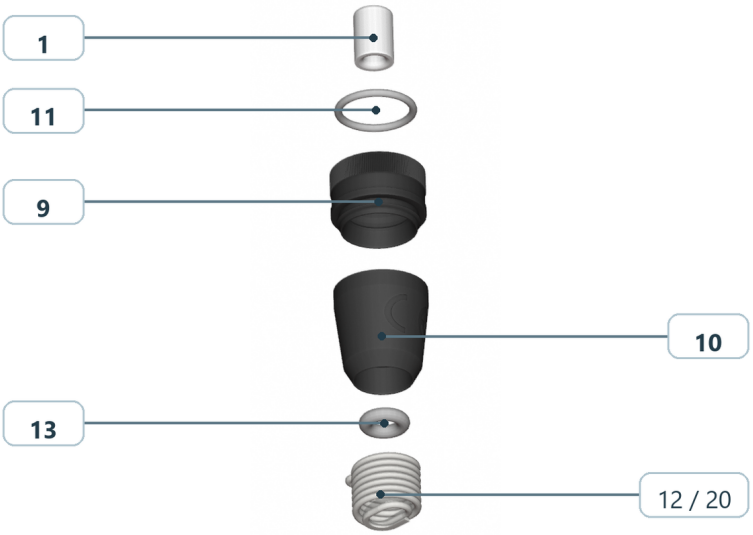

10 Spare parts

Item	Qty.	Description	Part number
1	1	Bush RS 9.5/11 × 36	052-0066
2	1	Cylinder	052-0183
3	1	Piston	052-0194
4	1	Valve sleeve	052-0354
5	1	Cylinder cover	052-0343
6	1	Pin	304-3431
7	1	Buffer	307-2541
8	1	Complete handle	052-0151
9	1	Clamping nut	052-0058
10	1	Silencer	307-2540
11	1	O-ring	307-2439
12	1	Spring cap	304-7806
13	1	O-ring	307-2076
14	1	Trigger	307-2339
15	1	Spring	304-7015
16	1	Plug	306-0200
17	1	Strainer	304-5069
18	1	Complete valve	052-0142
19	1	Valve bush; ream to fit 5H7 after installation	052-0141
20	1	Spring cap for cutting edges from 40 mm	304-7807

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the control system can damage the hammer. Always replace buffer 307-2541 during this work.

Variants and spare-parts orders
Spring caps 12 and 20 are alternatives. Item 20 is intended for cutting edges from 40 mm wide. State tool type, article number and shank when ordering. See Chapter 6 for fitting the O-ring and spring cap. Replace worn buffers and O-rings in good time.