
9 Exploded view FK 114.2

FK 114.2: item numbers correspond to the version shown. Blue links open the corresponding shop article.

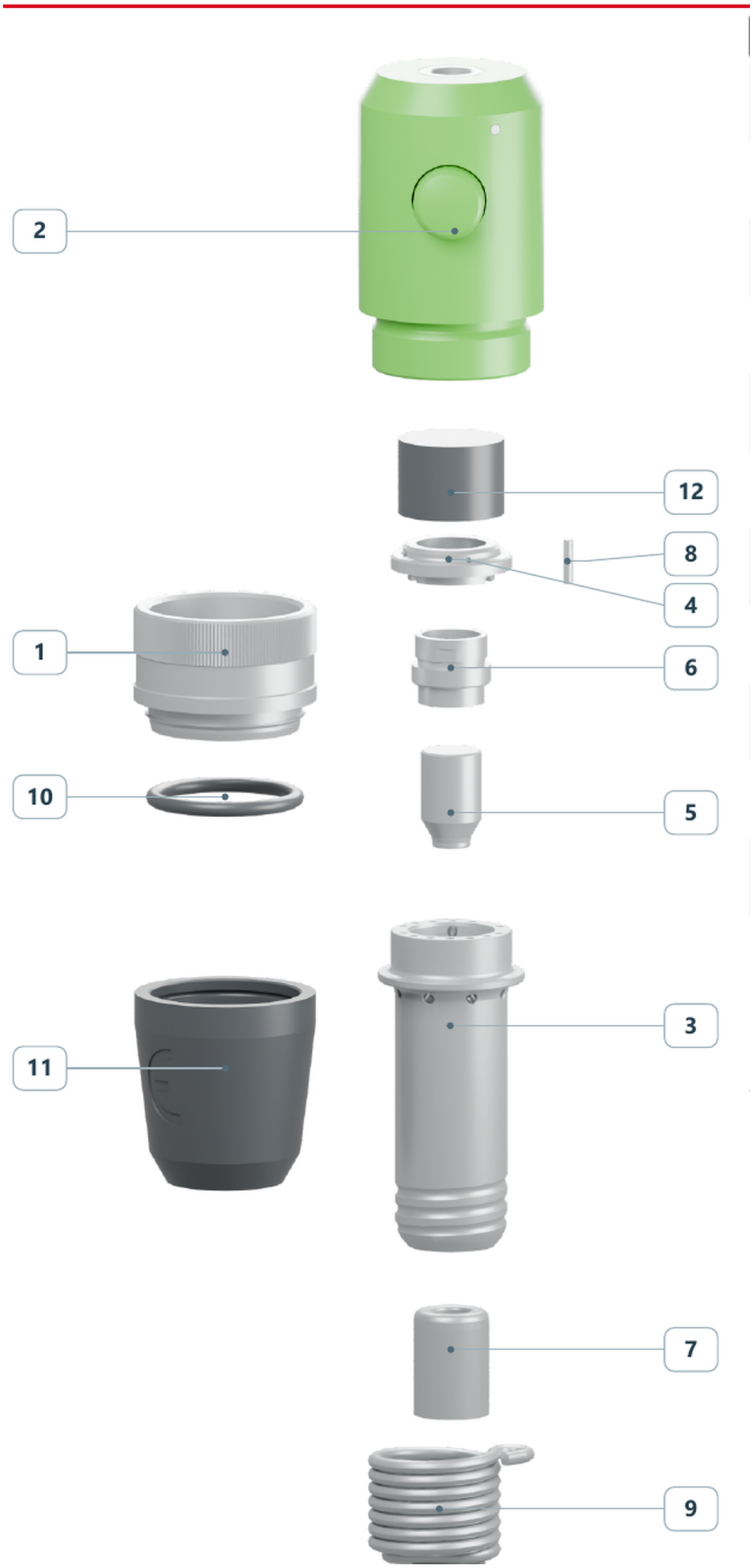

10 Spare parts

Item	Qty.	Description	Part number
1	1	Clamping nut	052-0058
2	1	Complete housing	052-0063
3	1	Cylinder	052-0173
4	1	Cylinder cover	052-0343
5	1	Piston	052-0352
6	1	Valve sleeve	052-0354
7	1	Chisel bush R 10.3 × 36	052-7233
8	1	Cylindrical pin	304-3431
9	1	Oval spring cap	304-7806
10	1	O-ring	307-2439
11	1	Silencer	307-2540
12	1	Buffer	307-2541

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the cylinder cover can damage the hammer. Always replace buffer 307-2541 during this work.

Variants and spare-parts orders
The exploded view shows the assemblies and spare-parts assignment. When ordering, state tool type, article number and shank. Spring cap (9) forms part of the tool retainer. Check O-ring (10), silencer (11) and buffer (12) for condition or abnormalities and replace in good time. Addition to the spare-parts list: O-ring 307-2076, quantity 1, belongs to spring cap 304-7806. The existing exploded view gives no separate spare-part position for this ring. See Chapter 6 for assembly.