
9 Exploded view FK 6.3 W

FK 6.3 W: exploded view for part identification; not a dimensioned drawing. Blue links open spare parts in the shop.

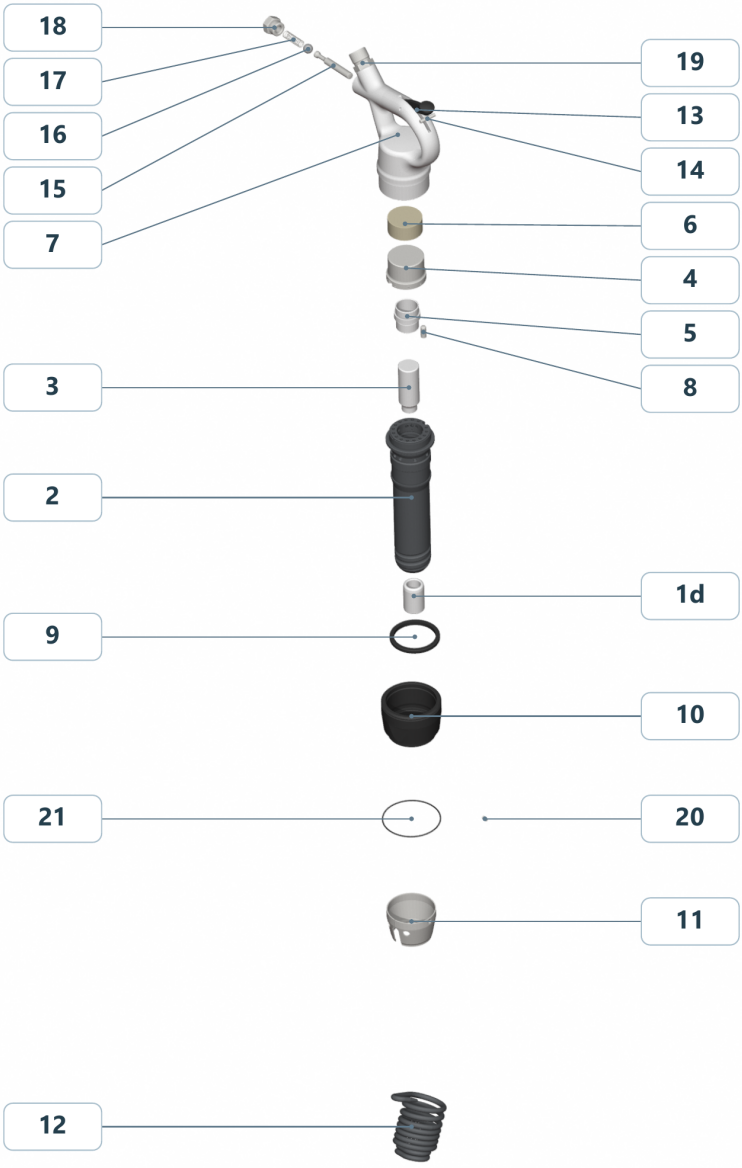

10 Spare parts

Item	Qty.	Description	Part number
1d	1	Bushing	052-0504
2	1	Cylinder	052-0547
3	1	Piston	052-0569
4	1	Cylinder cover	052-0284
5	1	Valve sleeve	052-0238
6	1	Buffer	307-2504
7	1	Complete handle	052-05351
8	1	Cylindrical pin	304-3630
9	1	Ring	307-2545
10	1	Clamping nut	052-0517
11	1	Exhaust clamp	304-7254
12	1	Spring cap	304-7801
13	1	Trigger	052-0057
14	1	Pin	304-3442
15	1	Valve	052-0117
16	1	Ball	307-1987
17	1	Spring	304-7018
18	1	Plug	306-0202
19	1	Nipple	052-7154
20	1	Pin	304-3628
21	1	O-ring	307-2167

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the cylinder cover can damage the hammer. Always replace buffer 307-2504 during this work.

Variants and spare-parts orders
052-60564W: bushing 1d; spring cap 12. State the article number and shank when ordering.