
9 Exploded view FK 713

Schematic parts identification. Blue links open spare parts in the shop.

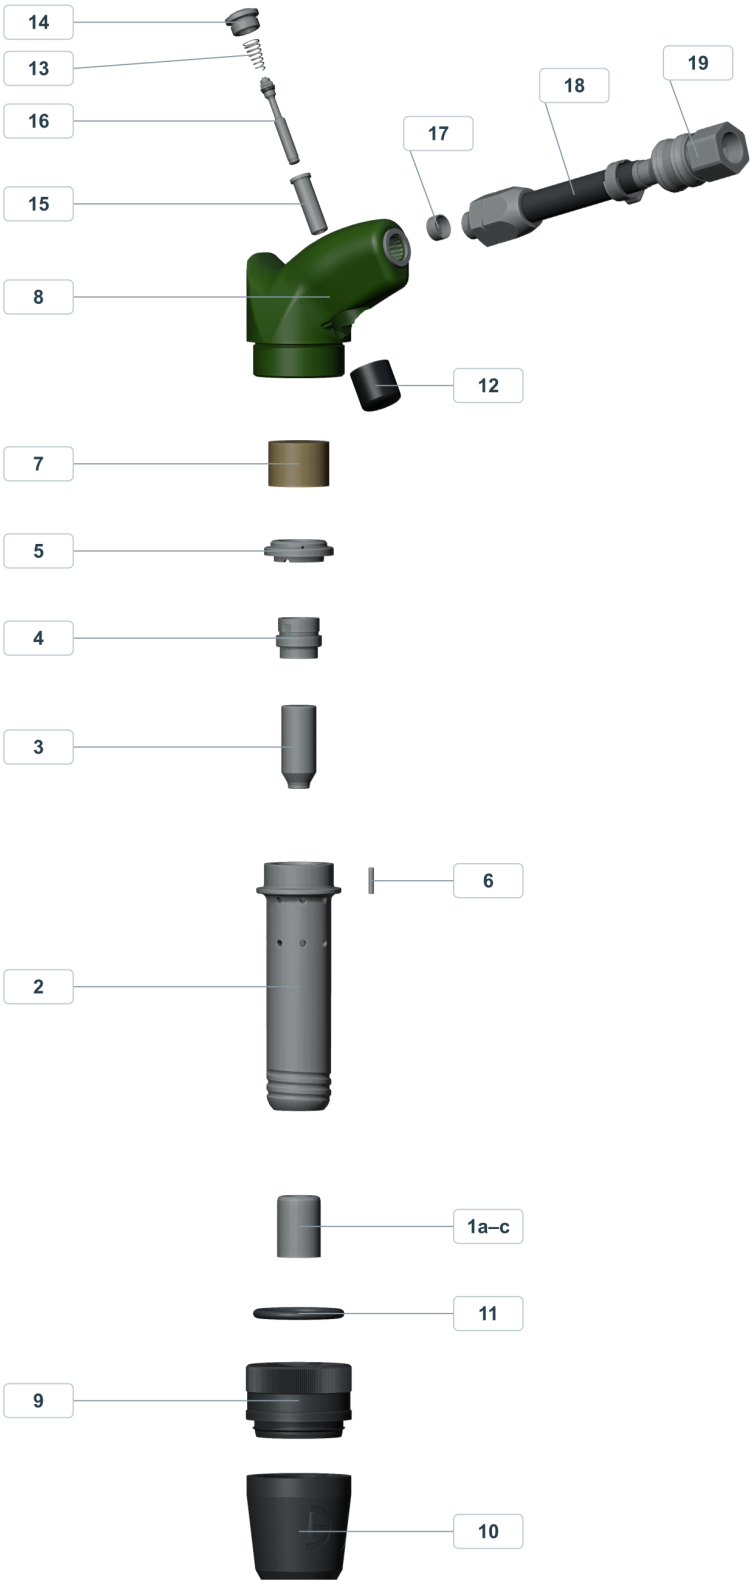

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bushing R 10.3 × 36	052-7233
1b	1	Bushing R 12.7 × 50	052-0043
1c	1	Bushing R 12.7 × 55	052-0083
2	1	Cylinder	052-0183
3	1	Piston	052-0194
4	1	Valve sleeve	052-0354
5	1	Cylinder cover	052-0343
6	1	Pin	304-3431
7	1	Buffer	307-2541
8	1	Complete handle	052-0151
9	1	Clamping nut	052-0058
10	1	Silencer	307-2540
11	1	O-ring	307-2439
12	1	Trigger	307-2339
13	1	Compression spring	304-7015
14	1	Plug	306-0200
15	1	Valve bushing	052-0141
16	1	Complete valve	052-0142
17	1	Strainer	304-5069
18	1	Hose without coupling	330-0160
19	1	Coupling	306-0805


NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the upper cover, lower cover or control plate can damage the hammer. Always replace buffer 307-2541 during this work.

Variants and spare-parts orders
Bushings and cylinder according to the version table. A additionally includes regulator 052-0087. Hose 330-0160 replaces 052-0160; coupling 306-0805 separately. The handle (8) is also available complete (052-0151).

9 Exploded view FK 713A

Schematic parts identification. Blue links open spare parts in the shop.

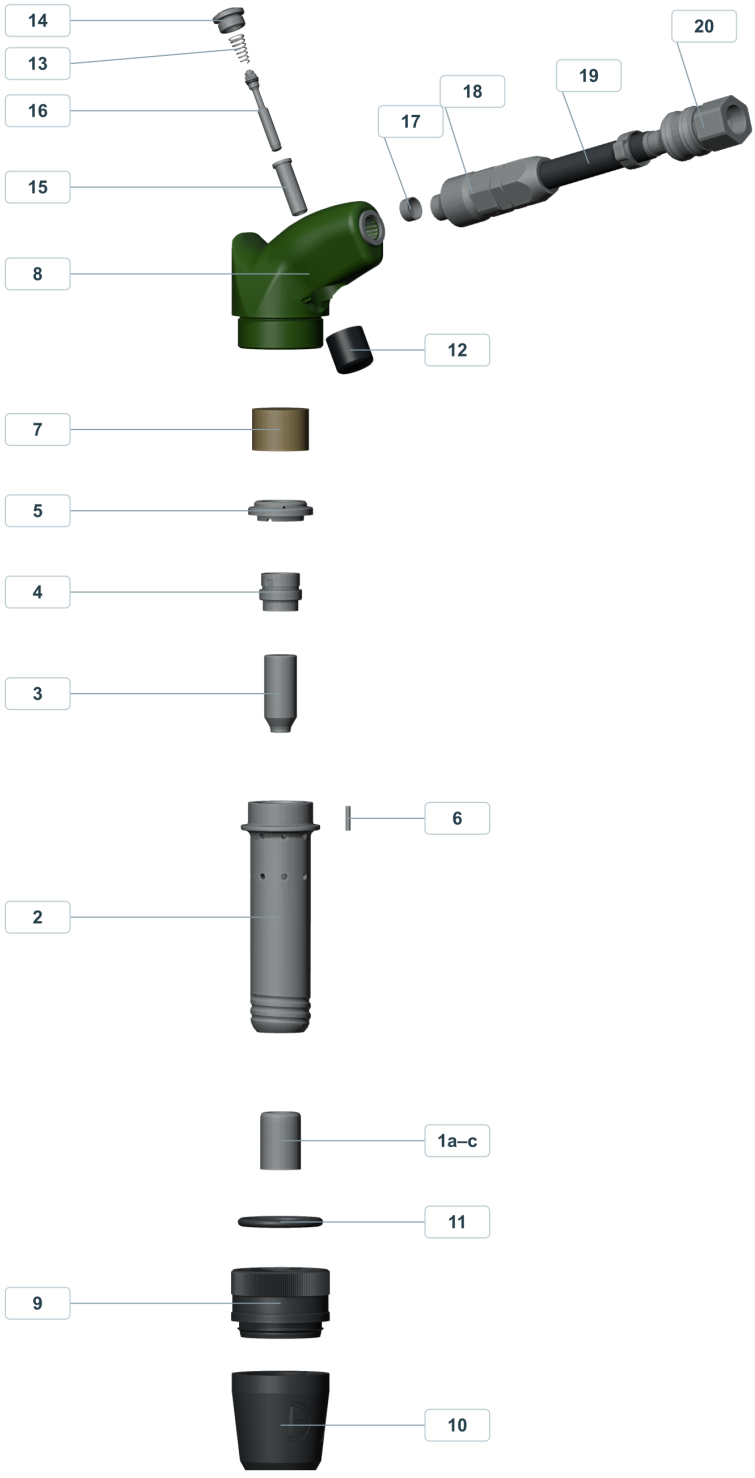

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bushing R 10.3 × 36	052-7233
1b	1	Bushing R 12.7 × 50	052-0043
1c	1	Bushing R 12.7 × 55	052-0083
2	1	Cylinder	052-0183
3	1	Piston	052-0194
4	1	Valve sleeve	052-0354
5	1	Cylinder cover	052-0343
6	1	Pin	304-3431
7	1	Buffer	307-2541
8	1	Complete handle	052-0151
9	1	Clamping nut	052-0058
10	1	Silencer	307-2540
11	1	O-ring	307-2439
12	1	Trigger	307-2339
13	1	Compression spring	304-7015
14	1	Plug	306-0200
15	1	Valve bushing	052-0141
16	1	Complete valve	052-0142
17	1	Strainer	304-5069
18	1	Regulator	052-0087
19	1	Hose without coupling	330-0160
20	1	Coupling	306-0805

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the upper cover, lower cover or control plate can damage the hammer. Always replace buffer 307-2541 during this work.

Variants and spare-parts orders
Bushings and cylinder according to the version table. A additionally includes regulator 052-0087. Hose 330-0160 replaces 052-0160; coupling 306-0805 separately. The handle (8) is also available complete (052-0151).