
9 Exploded view FK 9 R.1

FK 9 R.1 · 052-61741 · R 25 × 75. Current handle 052-8330. Blue links open spare parts in the shop.

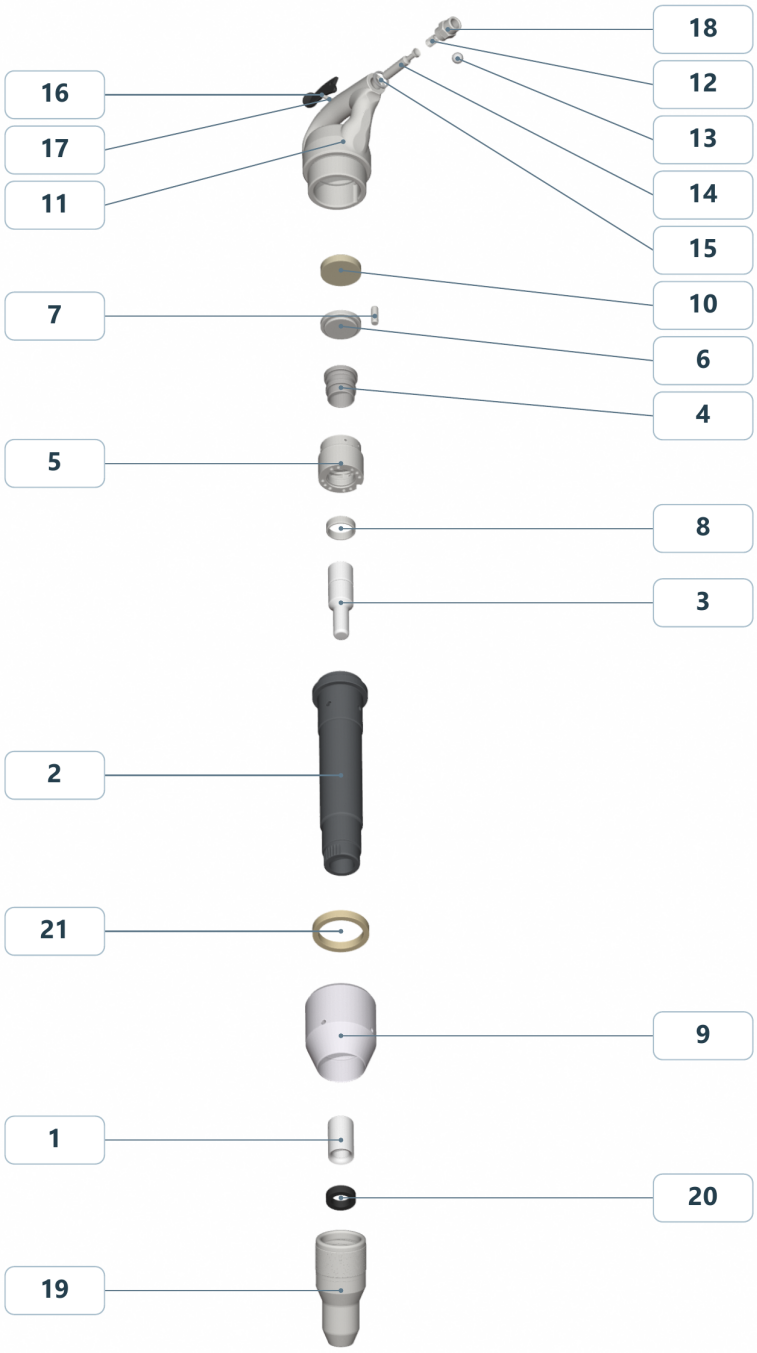

10 Spare parts

Item	Qty.	Description	Part number
1	1	Bushing	052-7872
2	1	Cylinder	052-7805
3	1	Piston	052-7806
4	1	Valve sleeve	052-7877
5	1	Valve housing	052-7807
6	1	Valve housing cover	052-7857
7	1	Pin	304-3635
8	1	Housing ring	052-7876
9	1	Clamping nut	052-2830
10	1	Buffer	307-2563
11	1	Complete handle	052-8330
12	1	Compression spring	304-7535
13	1	Ball	307-2088
14	1	Valve	052-7021
15	1	Sealing ring	313-531774
16	1	Trigger	052-0057
17	1	Pin	304-3442
18	1	Nipple	306-0223
20	2	Impact ring	307-2043
21	1	Ring	307-2516
19	1	Complete screw cap	052-7878


NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the control housing cover can damage the hammer. Always replace buffer 307-2563 during this work.

Variants and spare-parts orders
The drawing shows the current handle 052-8330 with trigger 052-0057 and nipple 306-0223. Before ordering spare parts, check the tool type, article number and existing configuration.

9 Exploded view FK 9 R.2

FK 9 R.2 · 052-61742 · S 22 × 82.5. Current handle 052-8330. Blue links open spare parts in the shop.

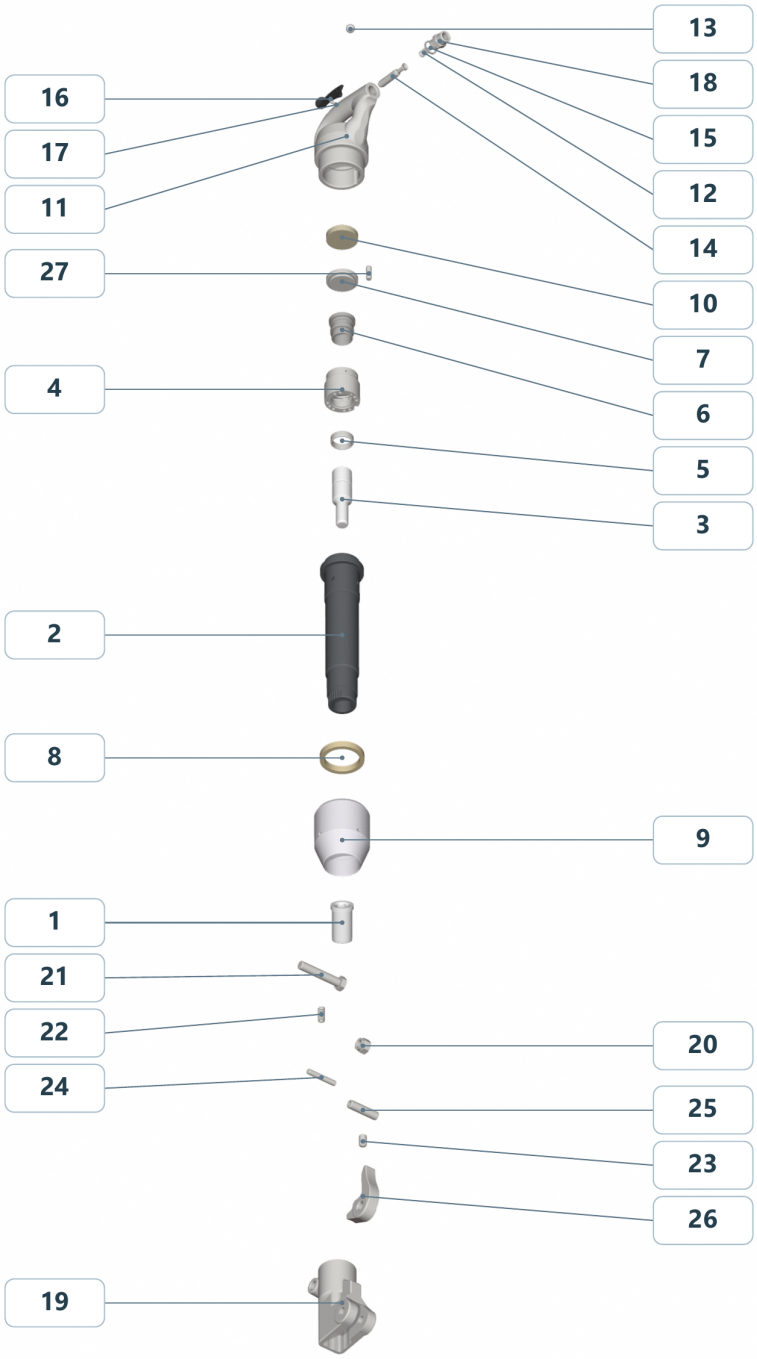

10 Spare parts

Item	Qty.	Description	Part number
1	1	Bushing	052-7504
2	1	Cylinder	052-7805
3	1	Piston	052-7806
4	1	Valve housing	052-7807
5	1	Housing ring	052-7876
6	1	Valve sleeve	052-7877
7	1	Valve housing cover	052-7857
8	1	Ring	307-2516
9	1	Clamping nut	052-2830
10	1	Buffer	307-2563
11	1	Complete handle	052-8330
12	1	Compression spring	304-7535
13	1	Ball	307-2088
14	1	Valve	052-7021
15	1	Sealing ring	313-531774
16	1	Trigger	052-0057
17	1	Pin	304-3442
18	1	Nipple	306-0223
20	1	Nut	308-110020
21	1	Screw	308-100105
22	1	Spring	304-7501
23	1	Pin	052-8115
24	1	Spring pin	304-3653
25	1	Spring pin	304-3654
26	1	Retaining lever	052-2846
27	1	Pin	304-3635
19	1	Complete retaining cap	052-2507

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the control housing cover can damage the hammer. Always replace buffer 307-2563 during this work.

Variants and spare-parts orders
The drawing shows the current handle 052-8330 with trigger 052-0057 and nipple 306-0223. Before ordering spare parts, check the tool type, article number and existing configuration.