
9 Exploded view FK 111.4 / FK 111.4S

FK 111.4 / FK 111.4S: item numbers correspond to the version shown. Blue links open the corresponding shop article.

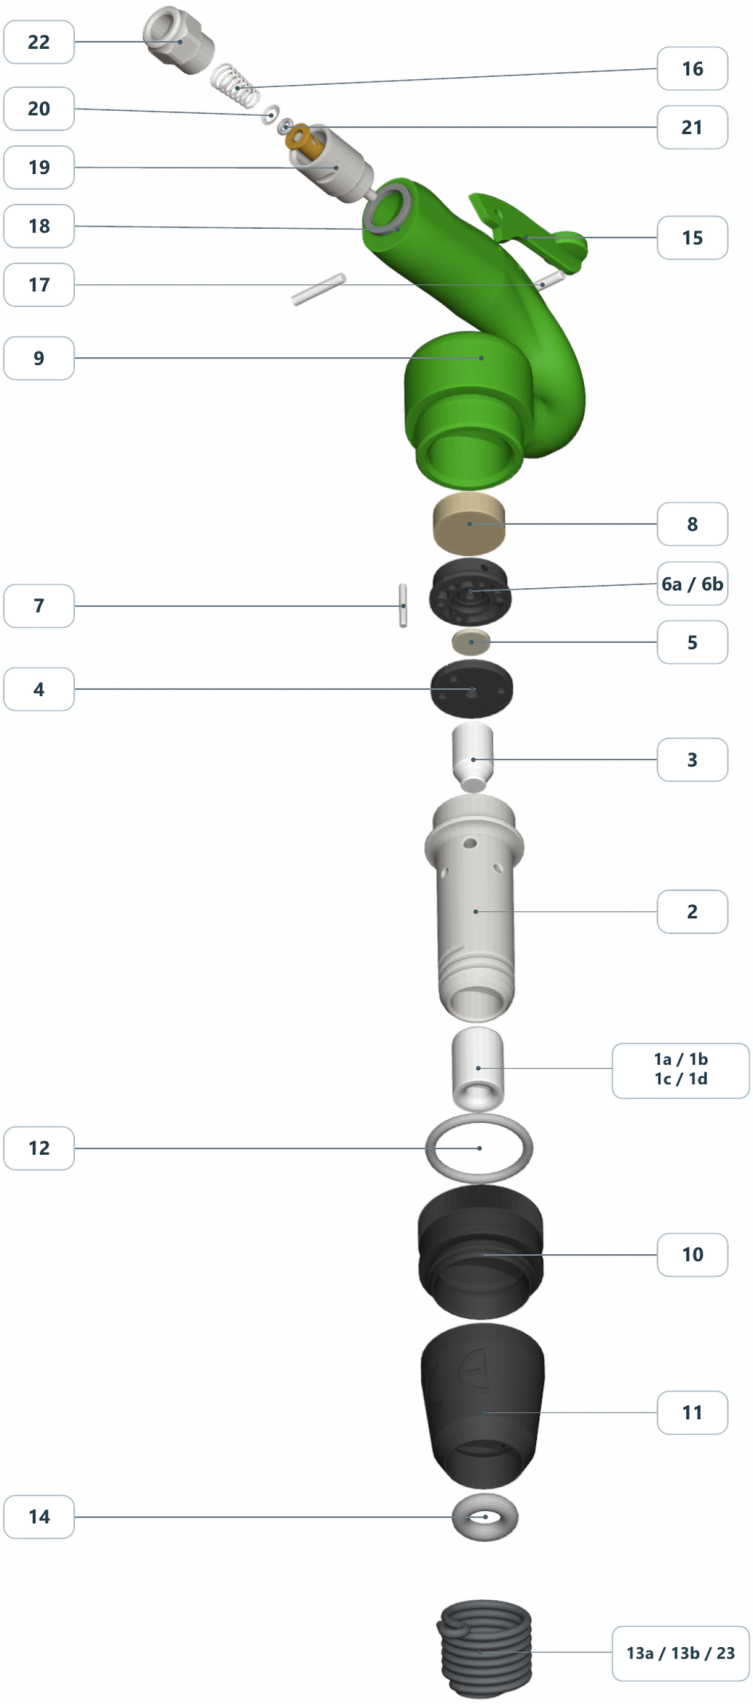

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bush S 12.5 × 36	052-7232
1b	1	Bush R 10.3 × 36	052-7233
1c	1	Bush RS 9.5/11 × 36	052-0066
1d	1	Bush RS 12.5/10.5/9.8	052-7234
2	1	Cylinder	052-0077
3	1	Piston	052-0078
4	1	Lower cover	052-0051
5	1	Valve plate	307-2337
6a	1	Upper cover	052-0050
6b	1	Upper cover	052-0054
7	1	Pin	304-5646
8	1	Buffer	307-2338
9	1	Complete handle	052-0300
10	1	Clamping nut	052-0058
11	1	Silencer	307-2540
12	1	O-ring	307-2439
13a	1	Oval spring cap	304-7806
13b	1	Round spring cap	304-7808
14	1	O-ring	307-2076
15	1	Trigger	052-0309
16	1	Spring	304-7103
17	1	Pin	303-1272
18	1	Pin	303-1273
19	1	Valve	052-0305
20	1	Serrated ring	304-5292
21	1	O-ring	307-2445
22	1	Nipple	052-0219
23	1	Spring cap for cutting edges from 40 mm	304-7807

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the upper cover, lower cover or control plate can damage the hammer. Always replace buffer 307-2338 during this work. Replace upper cover, lower cover and control plate together.

Variants and spare-parts orders
Variants: 052-5156 → 1b, 6a, 13a; 052-5166 → 1a, 6b, 13a; 052-6948 → 1c, 6b, 13b; 052-6940 → 1d, 6b, 13b. Item 23 is the alternative for cutting edges from 40 mm wide for all variants. All other items are shared. State tool type, article number and shank when ordering.