
9 Exploded view FK 3 G

FK 3 G: current exploded view for parts identification, not a dimensioned drawing. Blue links open spare parts in the shop.

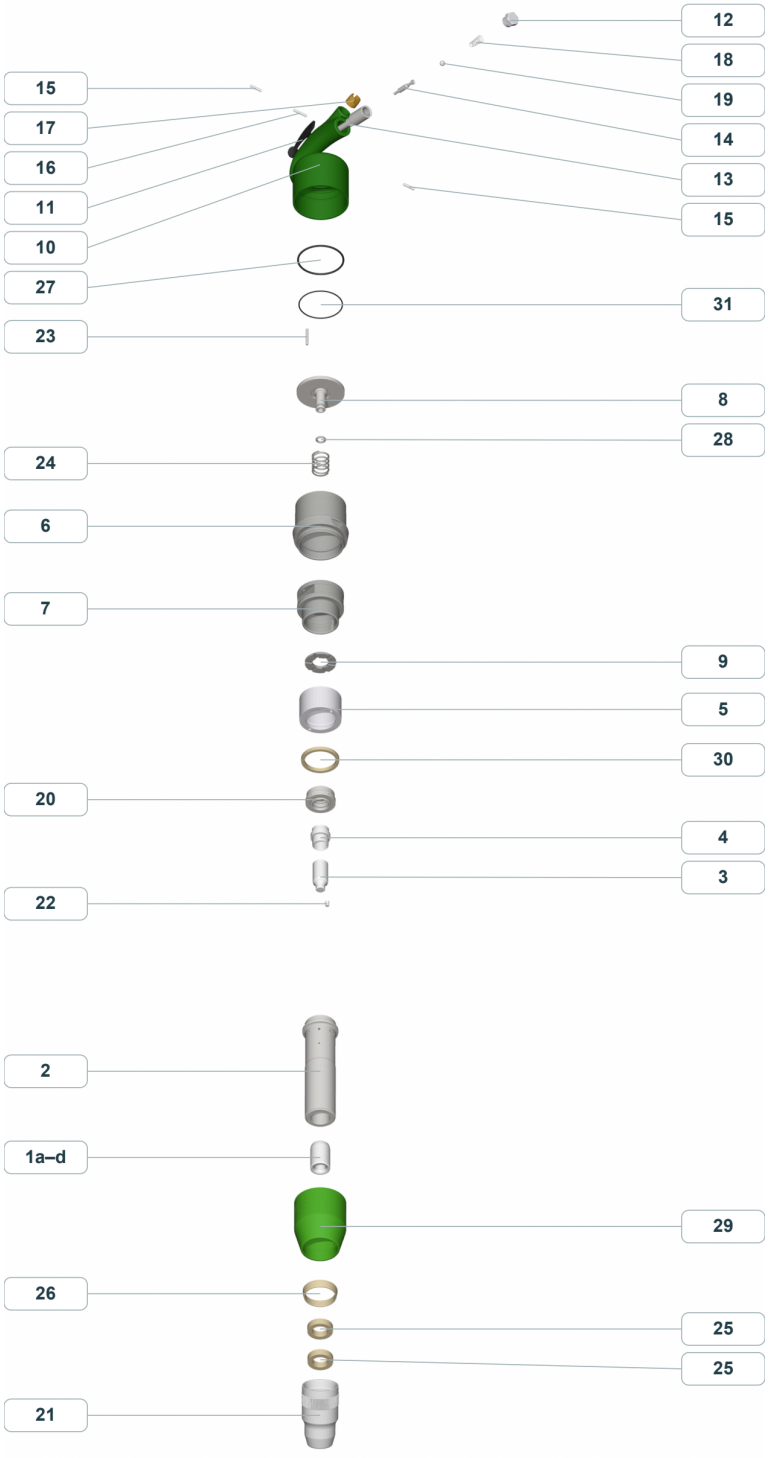

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Chisel bushing RS 17.5 × 60	052-0501
1b	1	Chisel bushing RS 20 × 60	052-0503
1c	1	Chisel bushing R 20 × 60	052-0504
1d	1	Chisel bushing R 17.5 × 60	052-0502
2	1	Cylinder	052-0560
3	1	Piston	052-0392
4	1	Valve sleeve	052-0384
5	1	Nut	052-005189
6	1	Hood	052-005191
7	1	Cylinder hood	052-005190
8	1	Disc guide	052-005197
9	1	Spacer ring	052-005312
10	1	Complete handle	052-006901
11	1	Trigger	052-0312
12	1	Plug	052-0328
13	1	Valve bushing	052-0329
14	1	Valve	052-0743
15	1	Pin D4 × 19.8	303-1272
16	1	Pin D4 × 32.8	303-1273
17	1	Threaded insert	304-2700
18	1	Compression spring	304-7103
19	1	Ball	307-2082
20	1	Cylinder cover	052-0383
21	1	Screw cap	052-8403
22	1	Pin D6 × 8	303-1282
23	1	Pin 5 × 30	304-3621
24	1	Compression spring	304-7520
25	2	Impact ring	307-2114
26	1	Conical ring	307-2115
27	1	O-ring 65 × 3	307-2168
28	1	O-ring 10 × 3	307-2481
29	1	Silencer	307-2537
30	1	Ring	307-2559
31	1	O-ring 63 × 2	307-2629

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

Variants and spare-parts orders
Two impact rings 307-2114 are required. Conical ring 307-2115 remains on the cylinder thread during normal chisel changes. Assignment: 1a → 052-59600; 1b → 052-59602; 1c → 052-59601; 1d → 052-59603. Handle (10) is also available complete (052-006901). State article number and shank when ordering. O-ring 307-2168 (27) is fitted to all variants.