
9 Exploded view FK 3

FK 3: Shared schematic comparison view with FK 2 for identifying parts, not a scale drawing. The list specifies FK 3 parts. Blue links open the article in the shop.

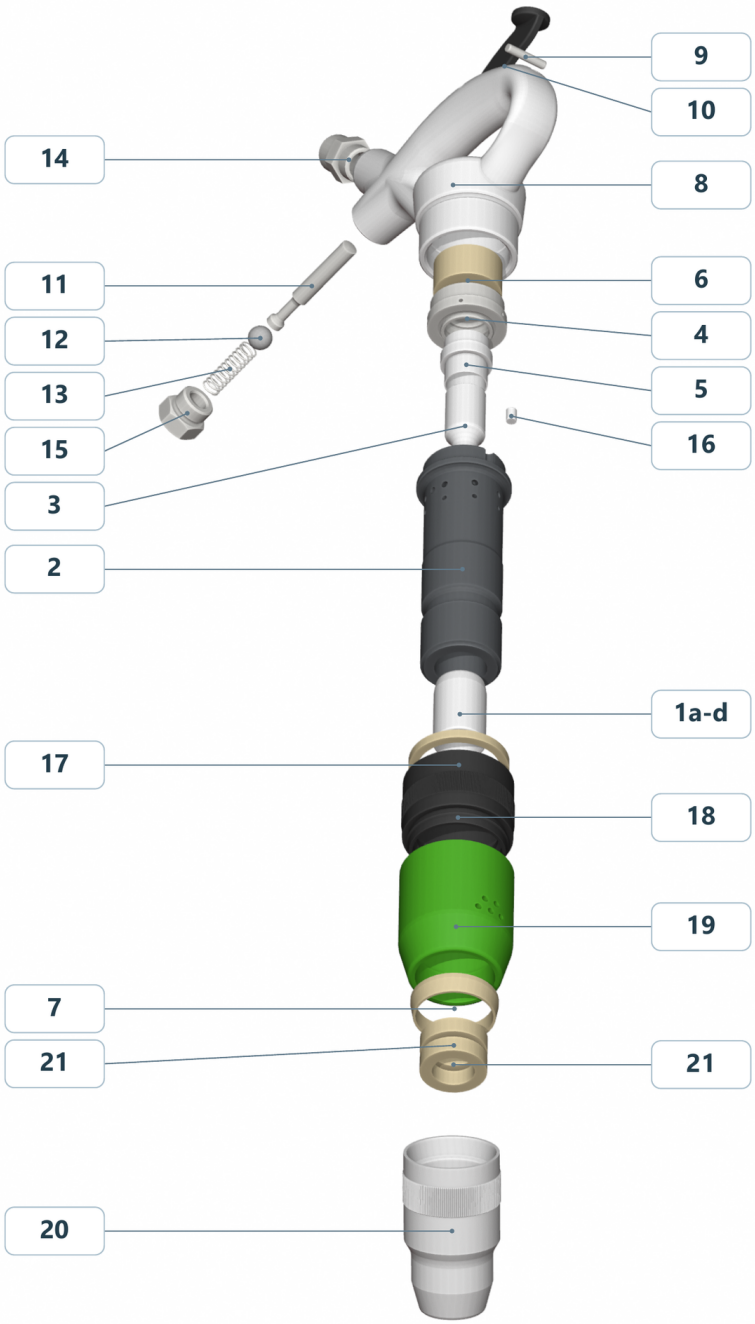

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bushing	052-0501
1b	1	Bushing	052-0502
1c	1	Bushing	052-0503
1d	1	Bushing	052-0504
2	1	Cylinder	052-0560
3	1	Piston	052-0392
4	1	Cylinder cover	052-0383
5	1	Valve sleeve	052-0384
6	1	Buffer	307-2505
7	1	Conical ring	307-2115
8	1	Complete handle	052-0525
9	1	Cylindrical pin	304-3442
10	1	Trigger	052-0057
11	1	Valve	052-0116
12	1	Ball	307-1987
13	1	Compression spring	304-7018
14	1	Nipple	306-0223
15	1	Plug	306-0202
16	1	Pin	303-1282
17	1	Ring	307-2559
18	1	Clamping nut	052-0527
19	1	Silencer	307-2538
20	1	Screw cap	052-8403
21	2	Impact ring	307-2114

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the cylinder cover can damage the hammer. Always replace buffer 307-2505 during this work.

Variants and spare-parts orders
052-59091: bush 1a; 052-59092: bush 1b; 052-59093: bush 1c; 052-59094: bush 1d. Screw cap 20 and both impact rings 21 apply to all four versions. State the article number and shank when ordering.