
9 Exploded view FK 4.3

FK 4.3: schematic exploded view for part identification; not a dimensioned drawing. The article numbers in the parts list are authoritative. Blue article numbers open the shop. This drawing shows the standard variant; W variants are shown on the following separate parts pages.

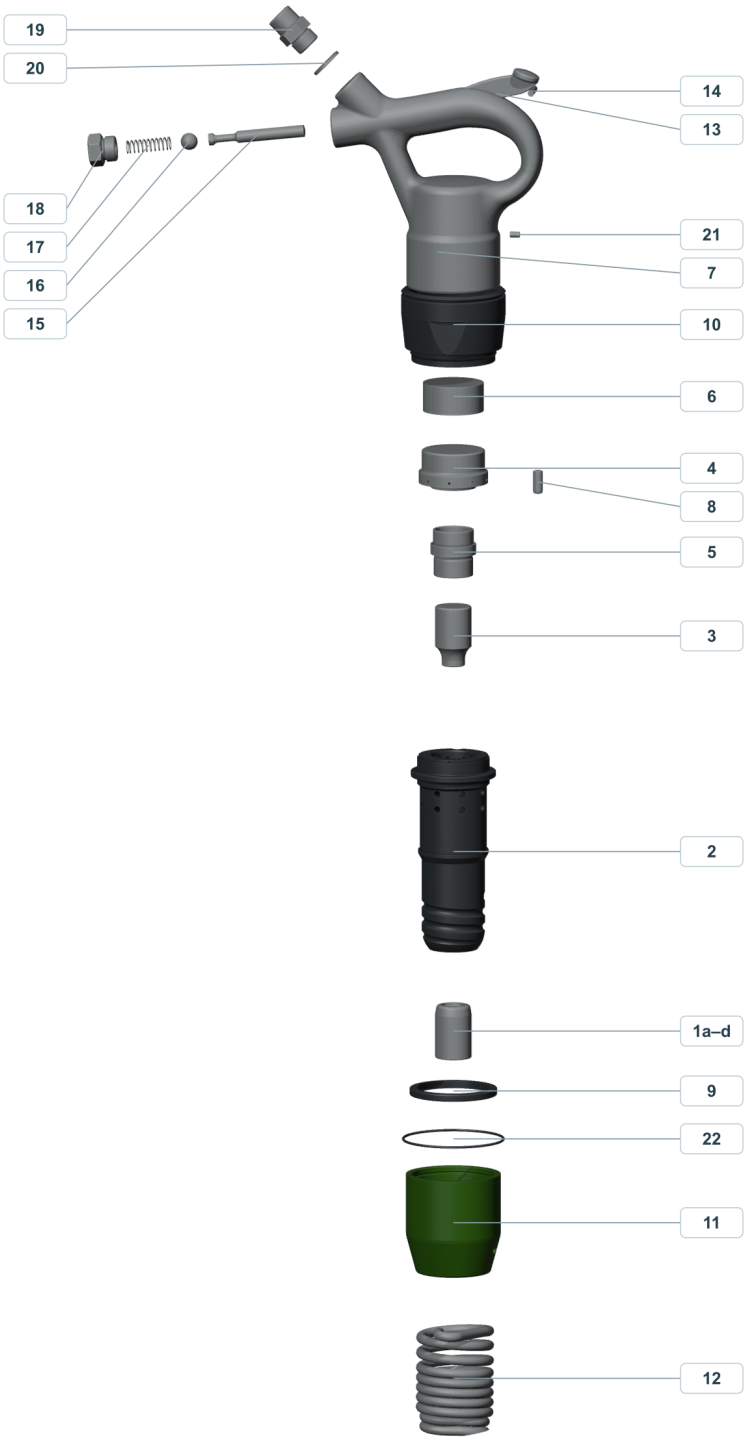

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bushing – RS 17.5	052-0501
1b	1	Bushing – R 17.5 × 60	052-0502
1c	1	Bushing – RS 20	052-0503
1d	1	Bushing – R 20 × 60	052-0504
2	1	Cylinder	052-0571
3	1	Piston	052-0549
4	1	Cylinder cover	052-0274
5	1	Valve sleeve	052-0238
6	1	Buffer	307-2504
7	1	Complete handle	052-0505
8	1	Cylindrical pin	304-3630
9	1	Ring	307-2545
10	1	Clamping nut	052-05071
11	1	Silencer	052-0567
12	1	Spring cap	304-7801
13	1	Trigger	052-0057
14	1	Pin	304-3442
15	1	Valve	052-0117
16	1	Ball	307-1987
17	1	Spring	304-7018
18	1	Plug	306-0202
19	1	Nipple	306-0223
20	1	Sealing ring OK-1/2	313-531774
21	1	Pin	304-3628
22	1	O-ring	307-2167


NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the existing buffer when replacing the cylinder cover can damage the hammer. Always replace buffer 307-2504 during this work.

Variants and spare-parts orders
052-60541A: bushing 1a; 052-60542A: bushing 1b; 052-60543A: bushing 1c; 052-60544A: bushing 1d. Spring cap 12 applies to all four standard variants. State the article number and shank when ordering. W article: 052-60643A.

Exploded view FK 4.3 W

052-60643A · RS 20 · Schematic part identification. Blue article numbers open spare parts in the shop.

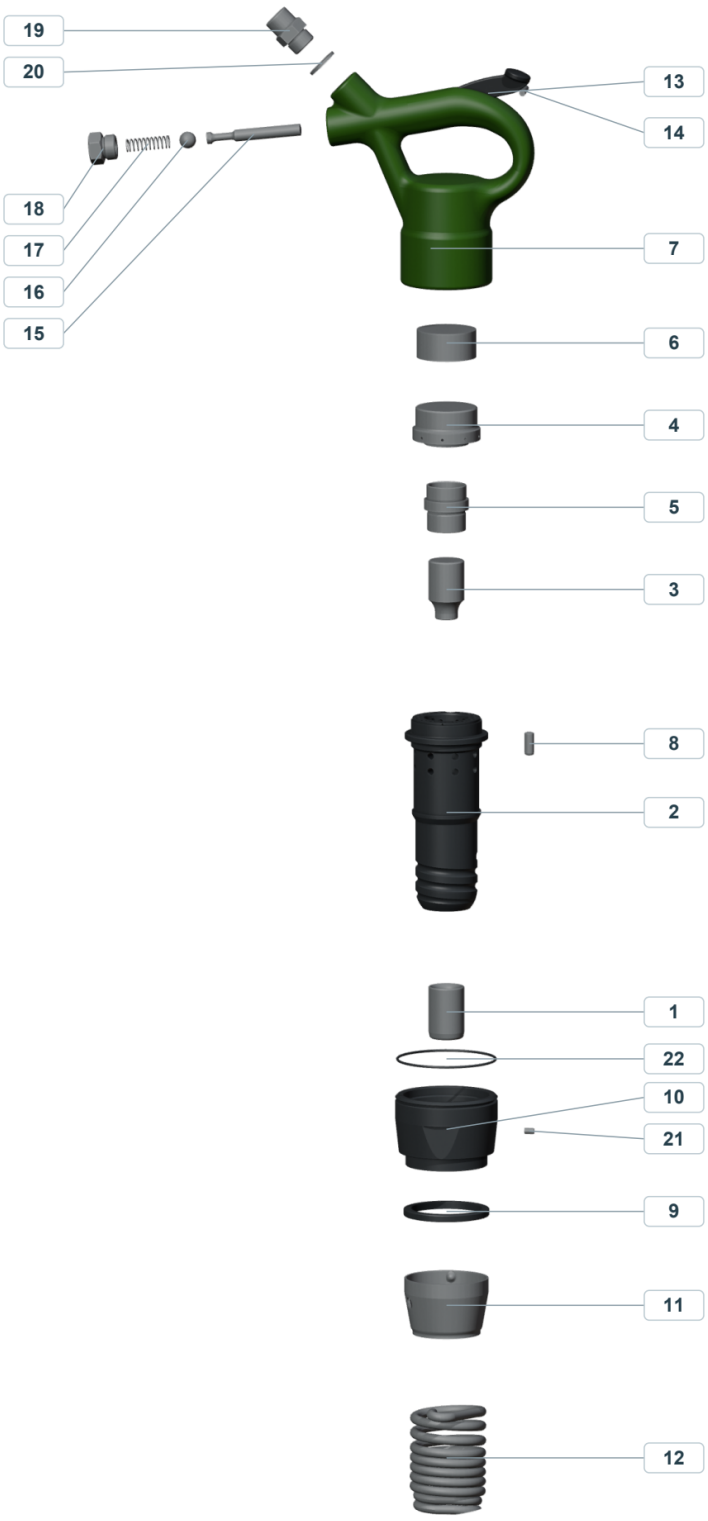

Spare parts

Item	Qty.	Description	Part number
1	1	Chisel bushing RS 20	052-0503
2	1	Cylinder	052-0571
3	1	Piston	052-0549
4	1	Cylinder cover	052-0274
5	1	Valve sleeve	052-0238
6	1	Buffer	307-2504
7	1	Complete handle	052-0505
8	1	Pin	304-3630
9	1	Ring	307-2545
10	1	Clamping nut	052-0517
11	1	Exhaust clamp	304-7254
12	1	Spring cap, oval	304-7801
13	1	Trigger	052-0057
14	1	Pin	304-3442
15	1	Valve	052-0117
16	1	Ball	307-1987
17	1	Compression spring	304-7018
18	1	Plug	306-0202
19	1	Nipple	306-0223
20	1	Sealing ring OK-1/2	313-531774
21	1	Pin	304-3628
22	1	O-ring	307-2167

NOTICE – Damage to the cylinder
Have chisel bushings replaced only by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Always replace buffer 307-2504 when replacing the tubular valve and cylinder cover.

Variant and spare-parts ordering
Applies to 052-60643A. Handle (7) is also available as a complete assembly (052-0505).