
9 Exploded view FK 703.5

Schematic parts identification. Blue links open spare parts in the shop.

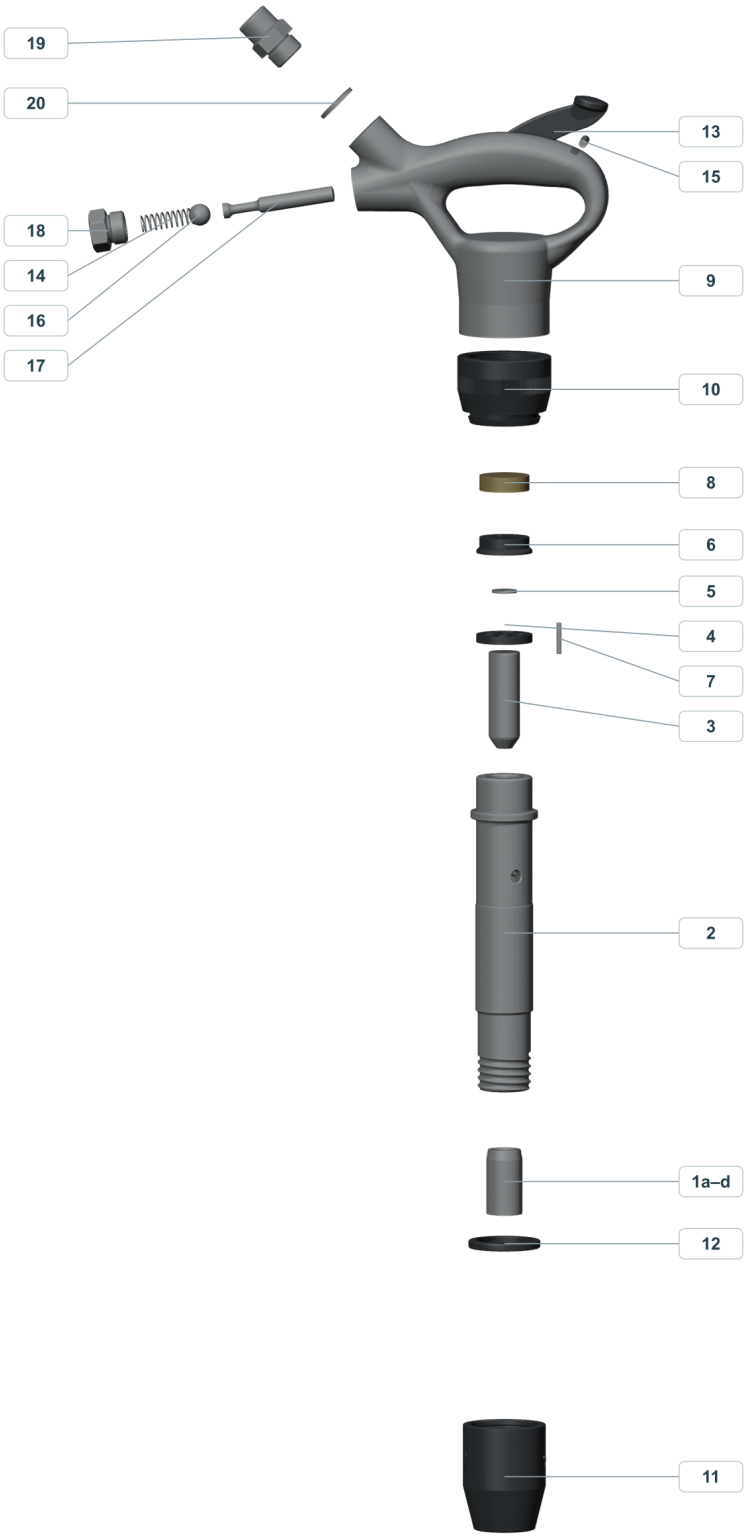

10 Spare parts

Item	Qty.	Description	Part number
1a	1	Bushing R 12.7 × 55	052-0040
1b	1	Bushing R 12.7 × 50	052-0073
1c	1	Bushing R 14.3 × 50	052-8247
1d	1	Bushing RK 13	052-8249
2	1	Cylinder	052-0034
3	1	Piston	052-0015
4	1	Lower cover	052-0053
5	1	Valve plate	307-2501
6	1	Upper cover	052-0052
7	1	Pin	304-5646
8	1	Buffer	307-2503
9	1	Complete handle	052-0095
10	1	Clamping nut	052-0103
11	1	Silencer	307-2539
12	1	Ring	307-2560
13	1	Trigger	052-0057
14	1	Spring	304-7018
15	1	Pin	304-3442
16	1	Ball	307-1987
17	1	Valve	052-0116
18	1	Plug	306-0202
19	1	Nipple	306-0223
20	1	Sealing ring OK-1/2	313-531774


NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the upper cover, lower cover or valve plate can damage the hammer. Always replace buffer 307-2503 during this work.

Variants and spare-parts orders
Bushing alternatives according to the version table. Nipple 306-0223: G 3/8 female. Handle (9) is also available complete (052-0095).

9 Exploded view FK 703.5A

Schematic parts identification. Blue links open spare parts in the shop.

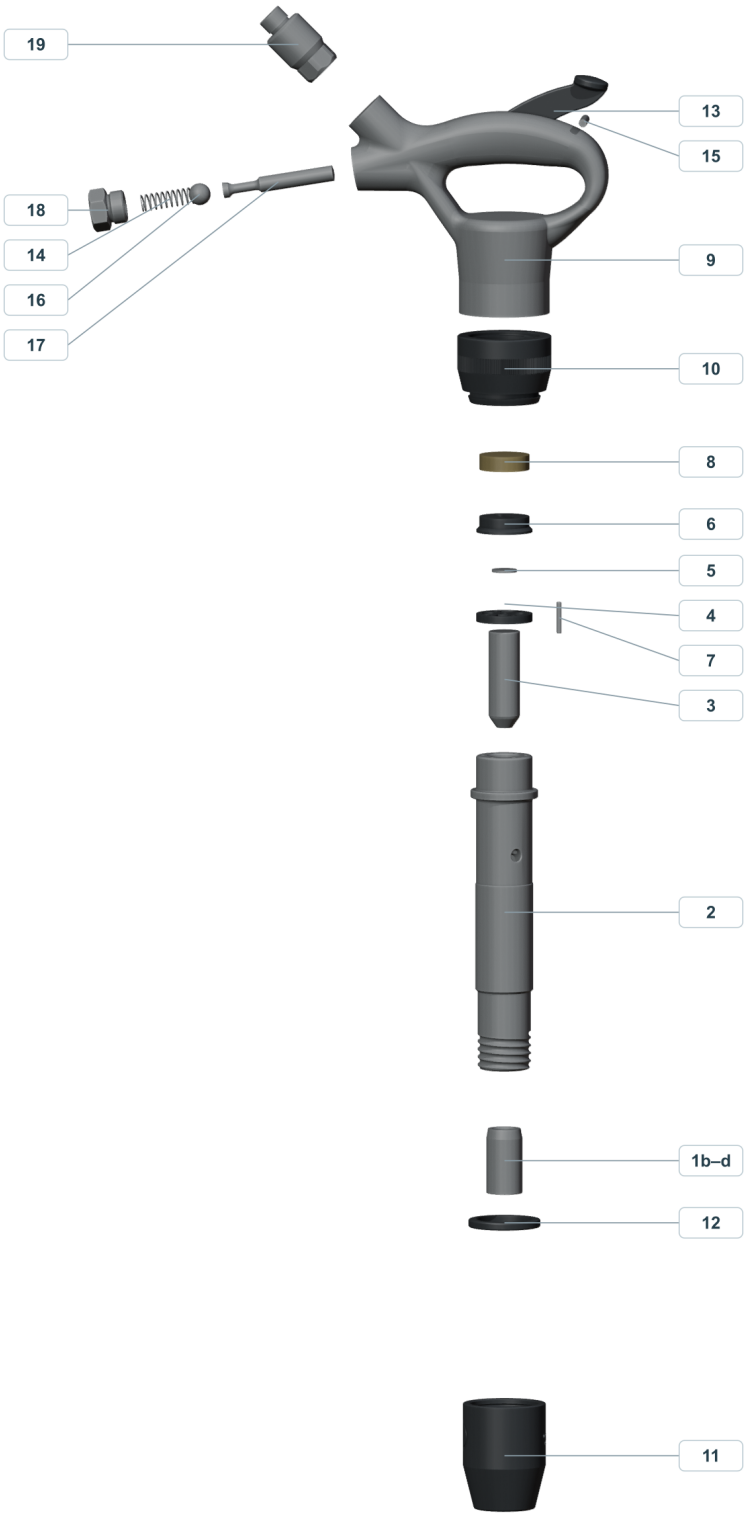

10 Spare parts

Item	Qty.	Description	Part number
1b	1	Bushing R 12.7 × 50	052-0073
1c	1	Bushing R 14.3 × 50	052-8247
1d	1	Bushing RK 13	052-8249
2	1	Cylinder	052-0034
3	1	Piston	052-0015
4	1	Lower cover	052-0053
5	1	Valve plate	307-2501
6	1	Upper cover	052-0052
7	1	Pin	304-5646
8	1	Buffer	307-2503
9	1	Complete handle	052-0095
10	1	Clamping nut	052-0103
11	1	Silencer	307-2539
12	1	Ring	307-2560
13	1	Trigger	052-0057
14	1	Spring	304-7018
15	1	Pin	304-3442
16	1	Ball	307-1987
17	1	Valve	052-0116
18	1	Plug	306-0202
19	1	Regulator	052-0097

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the upper cover, lower cover or valve plate can damage the hammer. Always replace buffer 307-2503 during this work.

Variants and spare-parts orders
Bushing alternatives according to the version table. A: regulator 052-0097 replaces nipple 306-0223 and sealing ring 313-531774. Handle (9) is also available complete (052-0095).