
9 Exploded view FK 7 R.1

FK 7 R.1 · 052-61731 · R 25 × 75. Current handle 052-8330. Blue links open spare parts in the shop.

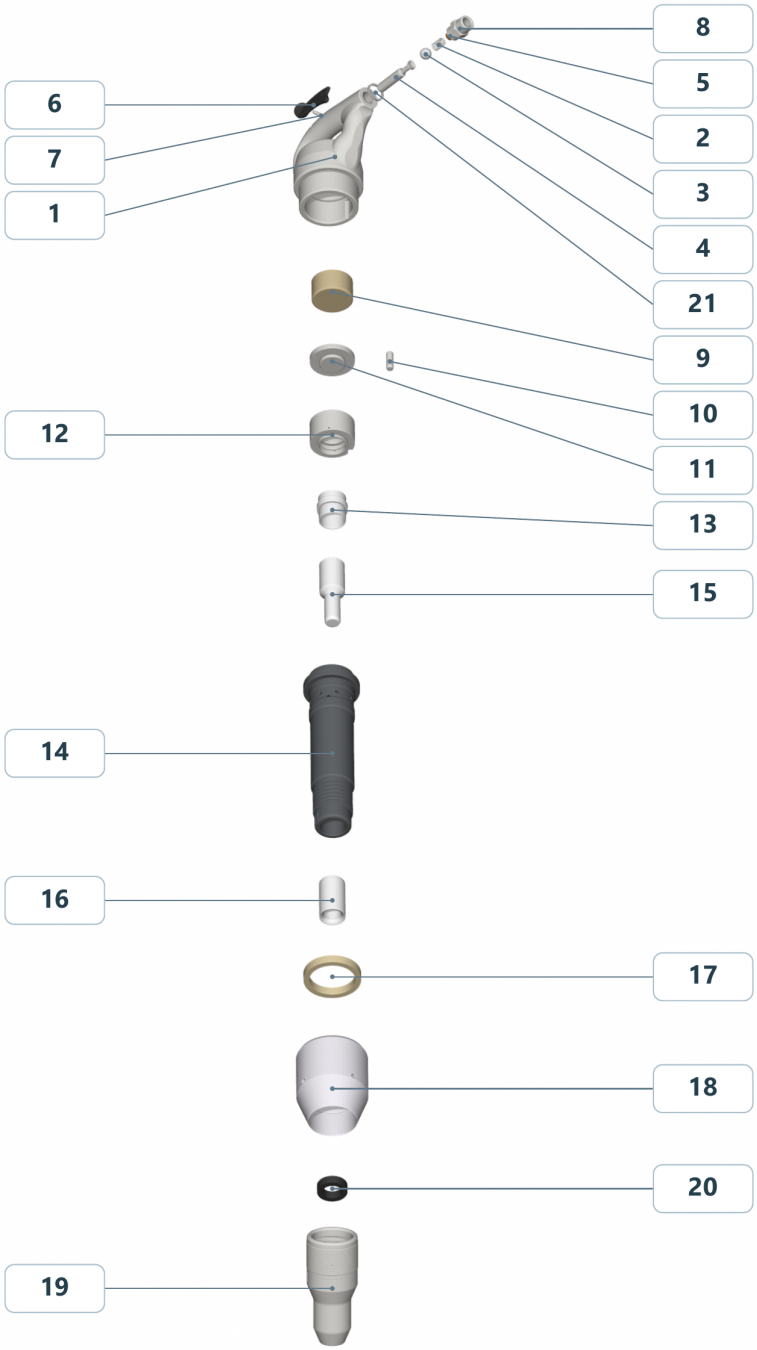

10 Spare parts

Item	Qty.	Description	Part number
16	1	Chisel bush	052-7872
1	1	Complete handle	052-8330
2	1	Compression spring	304-7535
3	1	Ball	307-2088
4	1	Valve	052-7021
5	1	Strainer	304-5069
6	1	Trigger	052-0057
7	1	Pin	304-3442
8	1	Nipple	306-0223
9	1	Buffer	307-2564
10	1	Pin	304-3635
11	1	Cover	052-7888
12	1	Valve housing	052-7887
13	1	Valve sleeve	052-0294
14	1	Cylinder	052-7885
15	1	Piston	052-7886
17	1	Ring	307-2516
18	1	Clamping nut	052-2830
21	1	Sealing ring	313-531774
20	1	Ring	307-2043
19	1	Complete screw cap	052-7878


NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the cover can damage the hammer. Always replace buffer 307-2564 during this work.

Variants and spare-parts orders
Since 2021, complete handle 052-8330 replaces handle 052-8320. The new complete handle also fits older hammers. Old handle: trigger 307-2049. New handle: trigger 052-0057. The new trigger does not fit the old handle. Check the handle version before ordering.

9 Exploded view FK 7 R.2

FK 7 R.2 · 052-61732 · S 22 × 82.5. Current handle 052-8330. Blue links open spare parts in the shop.

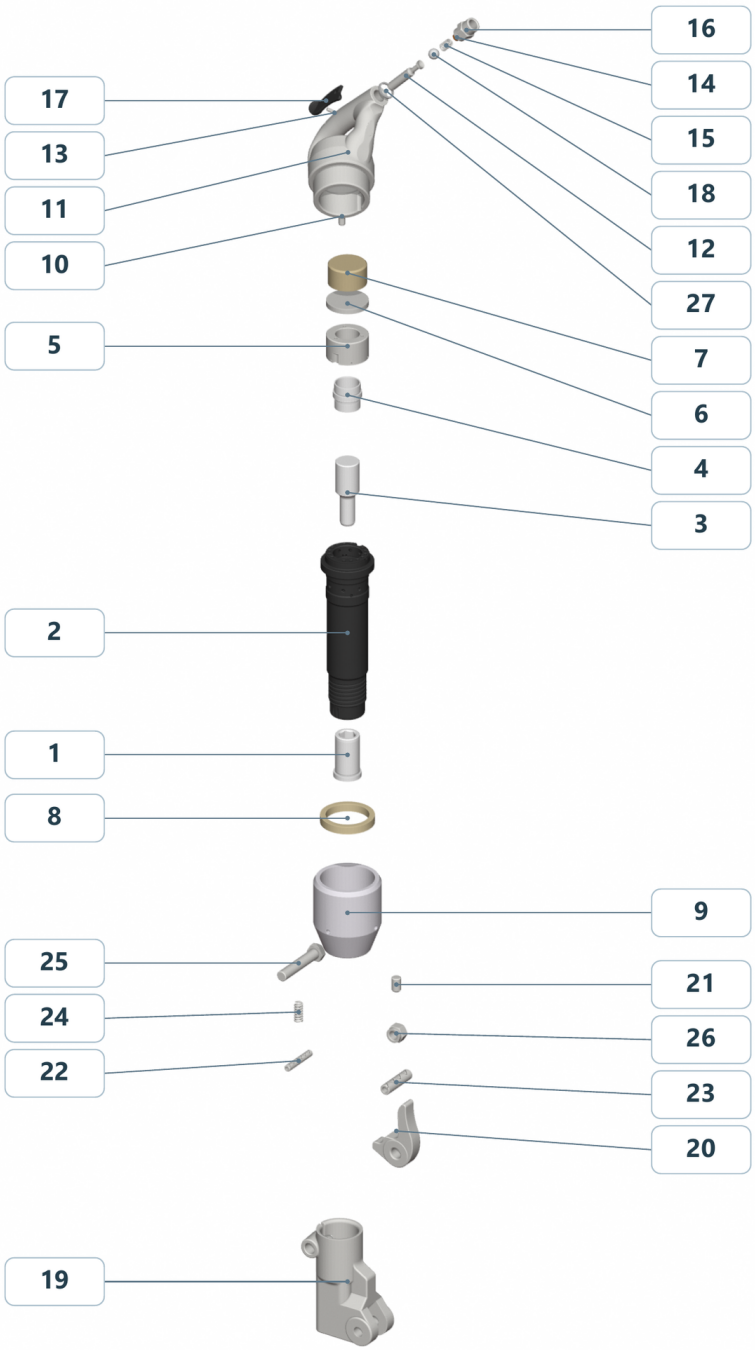

10 Spare parts

Item	Qty.	Description	Part number
1	1	Bushing	052-7504
2	1	Cylinder	052-7885
3	1	Piston	052-7886
4	1	Valve sleeve	052-0294
5	1	Valve housing	052-7887
6	1	Cover	052-7888
7	1	Buffer	307-2564
8	1	Ring	307-2516
9	1	Clamping nut	052-2830
10	1	Cylindrical pin	304-3635
11	1	Complete handle	052-8330
12	1	Valve	052-7021
13	1	Trigger pin	304-3442
14	1	Strainer	304-5069
15	1	Compression spring	304-7535
16	1	Nipple	306-0223
17	1	Trigger	052-0057
18	1	Ball	307-2088
27	1	Sealing ring	313-531774
20	1	Retaining lever	052-2846
21	1	Pressure pin	052-8115
22	1	Spring pin	304-3653
23	1	Spring pin	304-3654
24	1	Compression spring	304-7501
25	1	Hexagon head screw	308-100105
26	1	Hexagon nut	308-110020
19	1	Complete retaining cap	052-2507

NOTICE – Damage to the cylinder
Incorrect removal or replacement of the chisel bushing can damage the cylinder. Have chisel bushings replaced exclusively by F+K Service. Do not remove or replace them yourself.

NOTICE – Damage to the hammer
Reusing the old buffer when replacing the cover can damage the hammer. Always replace buffer 307-2564 during this work.

Variants and spare-parts orders
Since 2021, complete handle 052-8330 replaces handle 052-8320. The new complete handle also fits older hammers. Old handle: trigger 307-2049. New handle: trigger 052-0057. The new trigger does not fit the old handle. Check the handle version before ordering.